


SERVICE TIPS

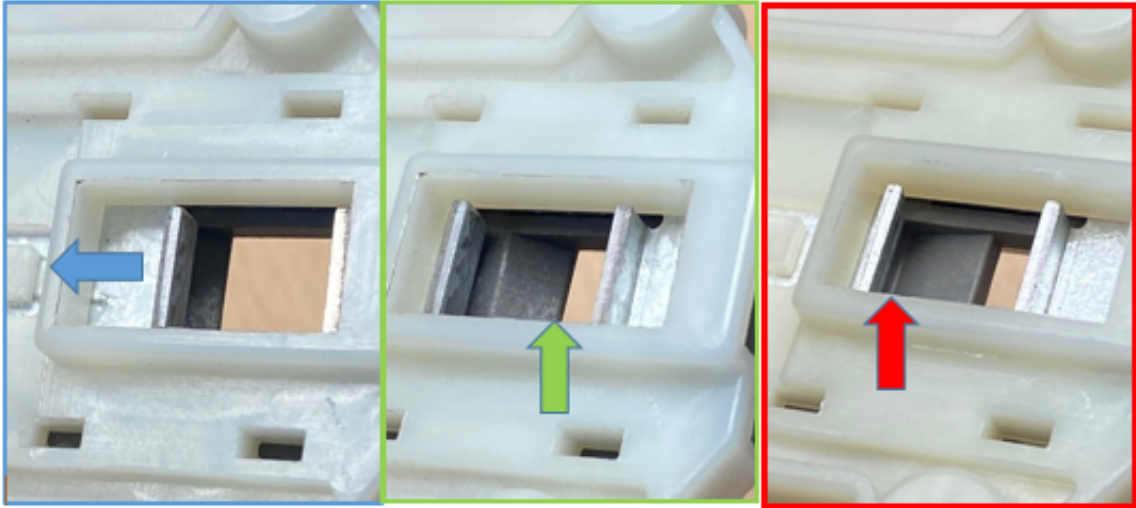

Continental Girbau • Girbau Industrial • Sports Laundry Systems
Onepress • Poseidon Textile Care • LG Commercial • Econo

Reference	Subject	Date
PB-131	Door Lock Bitrons	1/11/2021
Product	All 55 Pound and Smaller Girbau Built Washers (Excluding EH055)	

Summary	In 2020, Girbau Spain may have received incorrect door lock assemblies from our supplier, Bitron. The quantities, suspect parts, and dates are unknown. Incorrect Bitron door locks may have been introduced into production machines or service parts. This can cause issues with the door not locking, door not unlocking, and having to push at 10:00 on the door to open it. To inspect the Bitron, slide the locking tab to the side (blue arrow). Look closely at how the catch ramps. The GOOD Bitron (green) slopes towards the opening. The BAD Bitron slopes away from the opening. If you have a customer who has had repeated door lock issues on these units, please inspect the Bitron for the proper catch ramp slope. Please follow the typical warranty process.		
Model Information	 Manually slide and hold metal locking tab to the locked position Inspect Gray Plastic Slope Profile. Slope down toward the opening is GOOD Inspect Gray Plastic Slope Profile. Slope down and away from opening is BAD		
Part Numbers	Door lock bitron- 333302		



Always follow the warnings and procedures in the corresponding equipment instruction manual.