


Reference	Subject	Date
ST-111	E-Series Door Lock Upgrade	5/29/19
Product	EH060, EH070, and EH080	

Summary	Girbau S.A. and Continental Girbau updated door lock mechanisms on all products shipped from Oshkosh WI starting November 1st 2018 (XXXXXXXXM18) to reduce the noise from the chattering of the door locking mechanism and to eliminate door lock alarm codes. In addition, units produced after serial (XXXXXXXXB19) have additional updates to ensure full door closure, switch engagement, and door handle stop. - Door Lock Bar assembly (A), that has a roll pin in the base that eliminates premature door switch engagement - Door Lock Cam (B) has a rounded cam with a notch that eliminates premature door lock bar travel and door switch closure. - Lock End-Stop Plate (E) and lock end-stop spacer (C) replaces the original door lock rotation stop screw and nut.
Models	EH060, EH070, and EH080 – shipped from Oshkosh WI prior to November 1 st
Kit Part Number	10407484
Tools Required	25 mm Torx screwdriver, flathead screwdriver, 10 mm socket wrench, 5 mm Allen wrench, 19 mm or 3/4 in. deep wall socket or offset box end wrench, 5.5 mm wrench
Images	
Serial Number Range	Units produced in November 2018 and newer (XXXXXXXX M18).
Links	https://www.youtube.com/watch?v=6TxDVXTwaKc
Comments	Updating machines will be handled under the normal warranty process.

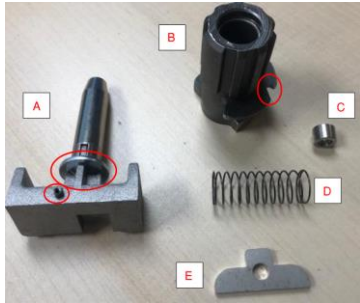

Always follow the warnings and procedures in the corresponding equipment instruction manual.